
Smoke and Dye Testing Summary

High Level Sewershed

Run Summary —								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-083	Smoke	9/11/2008	ADS/TM	S11CC1016MH	Dry	Yes	787.63	

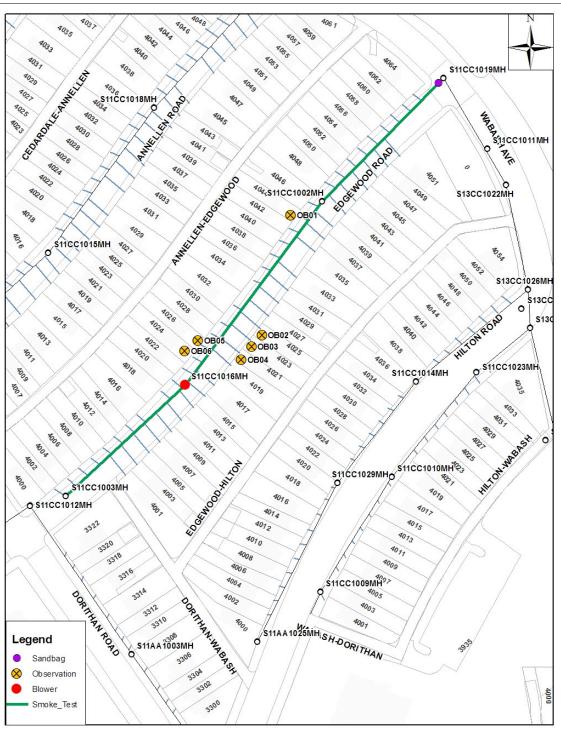

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary —									
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length		
S1028-083	Smoke	9/11/2008	ADS/TM	S11CC1016MH	Dry	Yes	787.63		

Isolated Pipes ————————————————————————————————————							
Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)			
S11CC1016G1	S11CC1016MH	S11CC1002MH	318.8916	8			
S11CC1003G1	S11CC1003MH	S11CC1016MH	227.8772	8			
S11CC1002G1	S11CC1002MH	S11CC1019MH	240.8643	8			

Observations & Photos

Obs_ID S1028-083-OB01 **Address** 4044 Edgewood Rd

 Status
 Private

 Source
 Cleanout

 Location
 Yard - front

 Nearest MH
 S11CC1002MH

Comments Smoke from cleanout in front yard. 4044 Edgewood Rd.



Picture \S1028-083-OB01-P01.jpg

Comments Front of house, 4044 Edgewood

Rd.

Obs_ID S1028-083-OB02 **Address** 4025 Edgewood Rd

Status Private **Source** Cleanout

Location Yard - front **Nearest MH** S11CC1016MH

Comments Smoke from cleanout in front yard. 4025

Edgewood Rd.



Picture \S1028-083-OB02-P01.jpg

Comments Front of house, 4025 Edgewood

Rd.

Smoke and Dye Testing Summary

High Level Sewershed

Run	Summary	
	Janimary	

Kun Summary									
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length		
S1028-083	Smoke	9/11/2008	ADS/TM	S11CC1016MH	Dry	Yes	787.63	_	

Obs_ID S1028-083-OB03 Address 4023 Edgewood Rd **Status** Private Source Cleanout Location Yard - front Nearest MH S11CC1016MH

Smoke from cleanout in front yard. 4023 Comments

Edgewood Rd.



Picture \S1028-083-OB03-P01.jpg

Comments Front of house, 4023 Edgewood

Obs_ID S1028-083-OB05 Address 4026 Edgewood Rd

Status Public

Source Service Lateral Location Yard - front

Nearest MH S11CC1016MH

Smoke from service lateral in front yard. 4026 Comments

Edgewood Rd.

Picture \S1028-083-OB05-P01.jpg

Front of house, 4026 Edgewood **Comments**

Obs_ID S1028-083-OB04 Address 4021 Edgewood Rd

Private Status Source Cleanout

Location Yard - front Nearest MH S11CC1016MH

Smoke fom cleanout in front yard. 4021 Comments

Edgewood Rd.



Picture \S1028-083-OB04-P01.jpg

Front of house, 4021 Edgewood Comments

Obs_ID S1028-083-OB06 Address 4024 Edgewood Rd

Status Private Source Cleanout

Location Yard - front Nearest MH S11CC1016MH

Smoke from cleanout in front yard. 4024 Comments

Edgewood Rd.



Picture \S1028-083-OB06-P01.jpg

Comments Front of house, 4024 Edgewood

